

## DO15 RC Indoor Phase VI Test Daily Notes

*Date: June 12, 2019*

*Time: 9:55 am*

*Cycle count: 564*

*Overlay Bottom Temp: T1 North: 26.94°F T1 South: 28.21°F*

*Ambient Temp: 70.43°F*

### North Section Observation

- 1 crack through SG1-N-0, approximately 2.5 inches (Fig 1).
- 1 crack through SG6-N-0, approximately 2.5 inches (Fig 2).
- Surface gage SG1-S-0 failed, and SG3-S-5 reads high strain.

### South Section Observation

- 1 crack through SG1-S-0, approximately 2.25 inches (Fig 3).
- Surface crack runs through SG3-S-5, length approximately from 14 to 34.5 inch (Fig 4)

### Issues

- No



Fig 1 Bottom-up crack at SG1-N-0

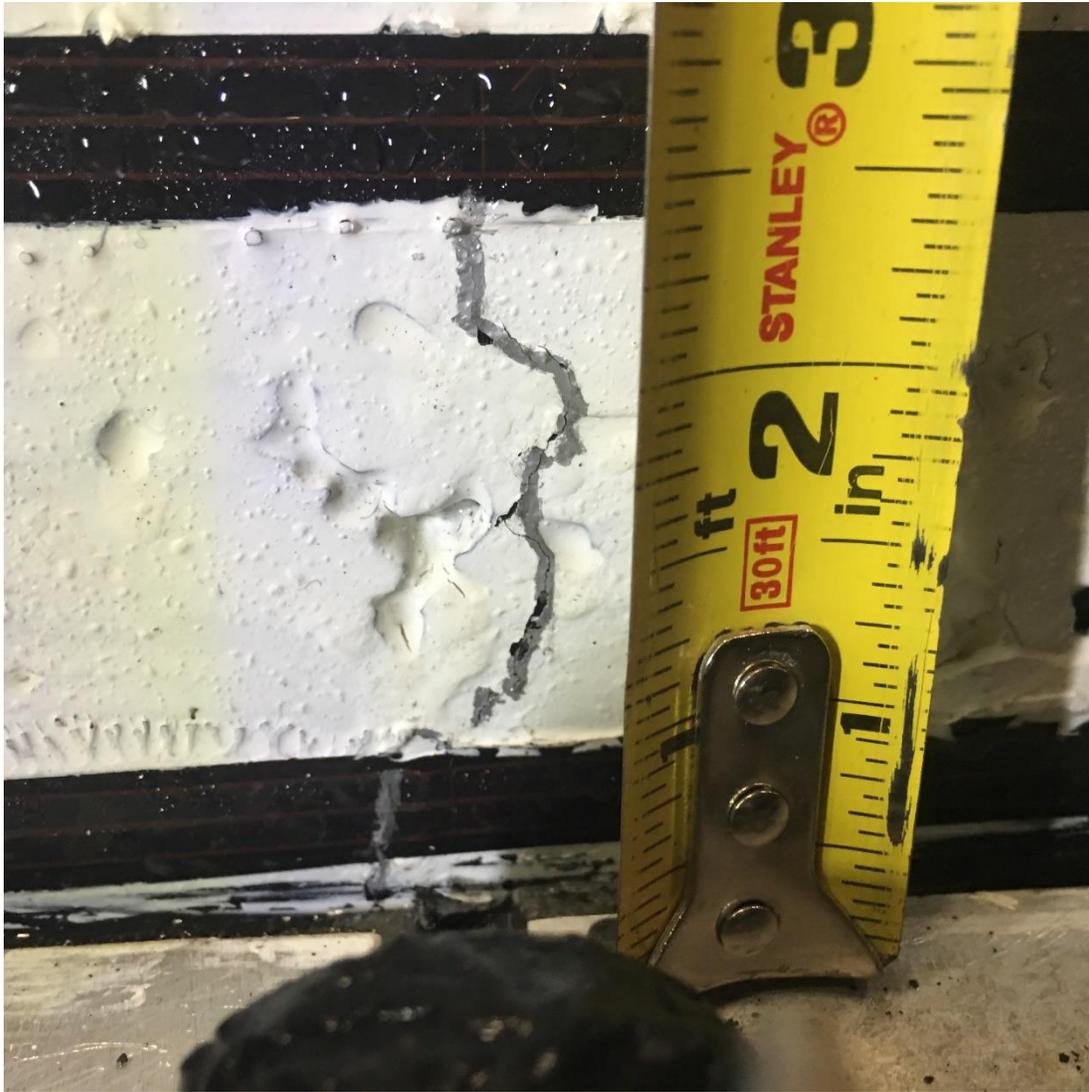


Fig 2 Bottom-up crack at SG6-N-0



Fig 3 Bottom-up crack at SG1-S-0



Fig 4 Surface crack on south section between 14'' and 34.5''